

Model Name	HES-5105-5102SFP+	Version	1.00.07	Designer	Approval
Part Name	Firmware	Date	2025/05/08		
Part Number	N/A	Unit	N/A		
File Name	HES-5105-5102SFP+_Release note_1.00.07_20250508.doc				

## Release Note

FIRMWARE VERSION 1.00.07 .....	2
FIRMWARE VERSION 1.00.06 .....	2
FIRMWARE VERSION 1.00.05 .....	2
FIRMWARE VERSION 1.00.04 .....	2
FIRMWARE VERSION 1.00.03 .....	3
FIRMWARE VERSION 1.00.02 .....	3
FIRMWARE VERSION 1.00.01 .....	4
FIRMWARE VERSION 1.00.00 .....	4



## Firmware Version 1.00.07

Date: 2025/05/08

New Feature / System Release	Description
N/A	N/A
Update	Description
LED / Status	The Status LED now correctly blinks orange after releasing the hardware reset button during the reset to factory default stage.

## Firmware Version 1.00.06

Date: 2025/05/05

New Feature / System Release	Description
N/A	N/A
Update	Description
Management / TACACS+	Changing the device hostname from the default value causes TACACS+ login failures.

## Firmware Version 1.00.05

Date: 2025/04/24

New Feature / System Release	Description
N/A	N/A
Update	Description
Management / User Account	Using a user login password with up to 64 special characters will cause the web page to display a "502 Bad Gateway" error.
Management / RADIUS/TACACS+	Using the same username for both RADIUS/TACACS+ and the local user account will cause login failure.

## Firmware Version 1.00.04

Date: 2025/04/21

New Feature / System Release	Description
N/A	N/A
Update	Description
Management / User Account	Extending the maximum length of the user account password to 64



	characters (including RADIUS and TACACS+).
TACACS+	Modify the "Remote address" parameter in the request to use the client IP address when communicating with the TACACS+ server for authentication, authorization, and accounting.
Switch Information	Using specific characters in the DHCP server option 12 host name may cause incorrect host name updates.
DHCP Client	When the switch receives a DHCP ACK packet that does not contain option 12 information, the switch will still retain the option 12 information of the first DHCP ACK packet received and perform the host name synchronization mechanism.

## Firmware Version 1.00.03

Date: 2025/03/05

New Feature / System Release	Description
N/A	N/A
Update	Description
DHCP Client	DUT will update option 12 with previous input when there is no option 12 in current DHCP ACK packet.

## Firmware Version 1.00.02

Date: 2025/02/26

New Feature / System Release	Description
DHCP Client	The device hostname can be assigned by the DHCP server using Option 12.
System Setup	System information supports a new parameter "Sync Host Name to System Name". Define: After being enabled, when the hostname is modified, the system will sync the same value to the system name (one-way).
Update	Description
Network Diagnostics	Diagnostic schedule add DNS with IPv6 dhcpv6 fail.
CLI	"show interface detailed 1" via CLI will find has no "Collisions" field.
Reset System / WEB	When the user clicks the reload button through the web page, the browsing screen will not switch to the waiting page.



## Firmware Version 1.00.01

Date: 2025/02/10

New Feature / System Release	Description
N/A	N/A
Update	Description
SSH	SSH might not remove old connection after randomly unplug cable.

## Firmware Version 1.00.00

Date: 2025/02/07

New Feature / System Release	Description
N/A	N/A
Update	Description
System	The Official Version.